



WEIGHING SCALES

- LCD display, with backlight
- Zero-setting, subtracting tare value
- Overload alarm
- Automatic power off
- Unit: kg, lb

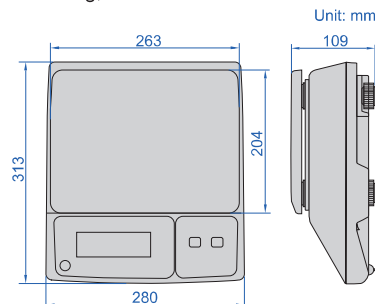

checking alarm (for scales with tri-colour alarm light)

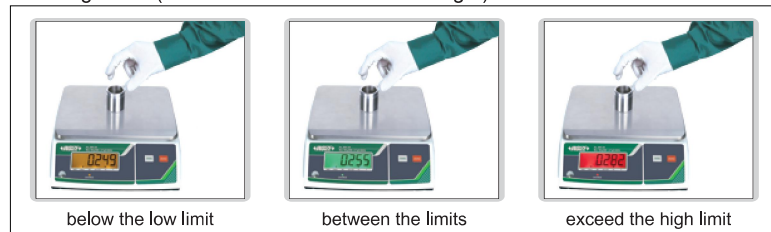

8001-6

OPTIONAL ACCESSORY (for scales with RS232)

Data output cable (keyboard format)	7302-8001
Wireless transmitter (receiver is needed)	7315-8001

SPECIFICATION

Code	8001-6	8001-15	8001-30	8001-6D	8001-15D	8001-30D
Maximum weighing	6kg	15kg	30kg	6kg	15kg	30kg
Minimum weighing	4g	10g	20g	4g	10g	20g
Resolution (d)	0.2g	0.5g	1g	0.2g	0.5g	1g
Accuracy (m is load)	m≤1kg: ±1g 1kg<m≤4kg: ±2g m>4kg: ±3g	m≤2.5kg: ±2.5g 2.5kg<m≤10kg: ±5g m>10kg: ±7.5g	m≤5kg: ±5g 5kg<m≤20kg: ±10g m>20kg: ±15g	m≤1kg: ±1g 1kg<m≤4kg: ±2g m>4kg: ±3g	m≤2.5kg: ±2.5g 2.5kg<m≤10kg: ±5g m>10kg: ±7.5g	m≤5kg: ±5g 5kg<m≤20kg: ±10g m>20kg: ±15g
Checking alarm	tri-colour alarm light			no		
Output	no			RS232		
Operation temperature	-10~40°C					
Power	rechargeable lead acid battery (6V/3.2Ah)					
Dimensions of pan	263×204mm					