


AIR GAUGE DISPLAYS





- Can store 10 measuring programs, and the programs can be switched quickly
- Data storage and query function

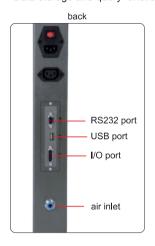






9408-QA101

SPECIFICATION

Code		9408-QD100 (without beep and light alarm)			9408-QA101 (with beep and light alarm)
LED quantity		101 pcs			
LED color		red, orange, green			
LED height		254mm			
Range, resolution and accuracy		range (µm)	resolution (µm)		accuracy
			LED	display	(µm)
		10	0.1	0.1	0.2
		20	0.2	0.1	0.4
		50	0.5	0.1	1
		100	1	0.2	3
Unit		mm, inch			
Air supply		dry and clean, 0.4~0.7MPa			
Data interface		RS232, USB			
Operation temperature	temperature	0~45°C			
	humidity	≤85%			
Power supply		AC185~265V, 50/60Hz			
Dimension (W×D×H)		160×160×490mm			
Weight		2.8kg			

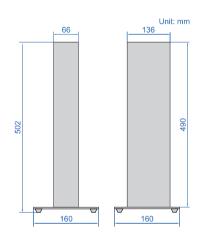

STANDARD DELIVERY

Main unit	1 pc



RS232 cable	9408-CB			
Foot switch	9408-FS (must be installed in factory)			
Data output cable (keyboard format)	7302-9408			
Wireless transmitter (receiver is needed)	7315-9408			
Air filter	9401-FILTER-A			
Pressure regulating valve	9404-PRV			



foot switch (optional)



RS232 cable (optional)







air filter (optional)